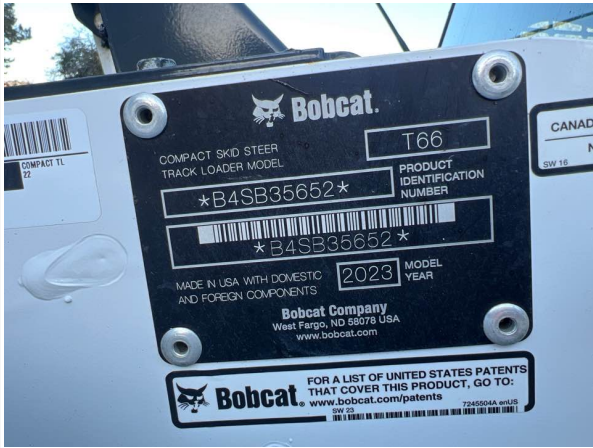



## Inspection Report (Skid Steer/Track Loader)

### General Info

B&B Stock Number	A4309195
Year	2023
Make	Bobcat
Model	T66
Serial Number	B4SB35652
Serial Plate Photo	
Hour Meter Reading	106
Hour Meter Photo	
Previous Application (e.g., earth moving, mining, demolition, etc)	Earth moving

### Features and Configuration

Travel System	Track Undercarriage
Bucket	Yes
Bucket Specs	68" bucket
Additional Attachment(s)?	Yes
Auxiliary Hydraulics (visual inspection only)	Yes
High Flow (visual inspection only)	Yes









## Inspection Report (Skid Steer/Track Loader)

Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	Yes
OMM (Operator & Maintenance Manual)	Yes
Telematics	No
Other Configuration Details / Notes	<p>auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale</p> <p>Enclosed cab Two speed Rear counter weights Bluetooth functionality</p>

## Exterior 360 Walkaround

### 360 Walkaround & Operating Video
















### Walkaround Photos & Operating Video

Exterior Walkaround Photos	    
	  
Operating Video	<a href="#">Click to Download</a>
Additional Video	<a href="#">Click to Download</a>
Additional Video	<a href="#">Click to Download</a>

## General Appearance Inspection Points

### General Appearance

### General Appearance Photos

Close-up Exterior Photos	    
	    
	    

## Inspection Report (Skid Steer/Track Loader)




### General Appearance Inspection Points

Inspection Rating Criteria	Rating	Explanation
	5	Light or minimal wear for its age
	4	Expected wear and tear for its age, operates as expected
	3	Above average wear and tear for its age, still operates as expected
	2	Heavy wear, is operable but needs attention
	1	Requires repair(s) to function as expected
Body Panels	5 - Very Light or Minimal Wear	
Doors / Canopy Latches	5 - Very Light or Minimal Wear	
Steps / Ladders	5 - Very Light or Minimal Wear	
Handrails	5 - Very Light or Minimal Wear	
Glass	5 - Very Light or Minimal Wear	
Mirrors	5 - Very Light or Minimal Wear	
Exterior Lights	5 - Very Light or Minimal Wear	
Overall Exterior	5 - Very Light or Minimal Wear	
Comments	Light to minimal wear no major issues to report	

### Control Station Inspection Points


#### Control Station

#### Control Station Photos

Control Station Photos					
Control Station Type	Enclosed Cab (EROPS)				









## Inspection Report (Skid Steer/Track Loader)

Control Type	Pilot Controls
Control Configuration	Configurable (SAE and ISO)
Seat	5 - Very Light or Minimal Wear
Cabin Lights	5 - Very Light or Minimal Wear
Safety Lock Out / Stop	5 - Very Light or Minimal Wear
Controls & Switches	5 - Very Light or Minimal Wear
Hour Meter Activity	5 - Very Light or Minimal Wear
Hour Meter Condition	Hour meter is functional and in good condition
Other Gauge Activity	5 - Very Light or Minimal Wear
Heater & A/C	5 - Very Light or Minimal Wear
Travel Alarm	5 - Very Light or Minimal Wear
Horn	5 - Very Light or Minimal Wear
Backup Camera	5 - Very Light or Minimal Wear
Control Station Overall Rating	5 - Very Light or Minimal Wear
	 36.973130, -121.994460

## Engine Inspection Points









### Engine

### Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					



## Inspection Report (Skid Steer/Track Loader)

	    
	  
Engine Type (Make, Model, Cylinders, Hp)	Bobcat
Emissions Tier	Undetermined
Engine Serial Number	DM02-LEL00
Engine Fuel Type	Diesel
Blow-by (Visual Observation Check)	No
Unusual Noises (Upon Start-up, Idle, Shutdown)	No
Engine Smoke (Upon Start-up, Idle, Shutdown)	No
Engine Exhaust Color	Clear
Battery	5 - Very Light or Minimal Wear
Battery Condition	Inaccessible, unable to determine condition, Clean & dry appearance, tight connections
Radiator	5 - Very Light or Minimal Wear
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks
Belts	5 - Very Light or Minimal Wear
Belt Condition	Belts appear in good condition & alignment with proper tension
Hoses	5 - Very Light or Minimal Wear
Hose Condition	Firm, pliant hoses with no signs of wear or leaks
Water Pump	5 - Very Light or Minimal Wear
Water Pump Condition	No unusual pump noises heard
Cooling System Leaks	No
Coolant Appearance	5 - Very Light or Minimal Wear
Coolant Appearance Notes	Normal Translucent appearance, no visual signs of contamination
Oil Leaks	No
Oil Appearance	5 - Very Light or Minimal Wear
Oil Appearance Notes	Clean oil appearance, no signs of cross contamination


## Inspection Report (Skid Steer/Track Loader)

Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	No
Requires DEF (Diesel Exhaust Fluid)	No
Overall Engine Rating	5 - Very Light or Minimal Wear
Overall Engine Appearance	Clean & dry
Overall Engine Comments	Light to minimal wear no major issues to report

## Drivetrain Inspection Points

### Drivetrain

## Drivetrain Inspection Points

Drivetrain Photos					
Hydrostatic Transmission?	Yes				
Speeds	2 Speed				
Drive Type	N/A (Track Undercarriage)				
Transmission Components	5 - Very Light or Minimal Wear				
Transmission Condition	Good forward and reverse function, No unusual noises or vibrations				
Drive Motors (first gear & reverse)	5 - Very Light or Minimal Wear				
Parking Brake	5 - Very Light or Minimal Wear				
Parking Brake Function	Good brake function				
Overall Drivetrain Rating	5 - Very Light or Minimal Wear				
Overall Drivetrain Comments	Light to minimal wear. No major issues to report.				

## Travel System Inspection Points

### Rubber Track Undercarriage

## Undercarriage Photos

Undercarriage Photos					
----------------------	--	--	--	--	--


## Inspection Report (Skid Steer/Track Loader)



### Inspection Points

Track Width (inches)	13"
Roller Frames	5 - Very Light or Minimal Wear
Track Belt	5 - Very Light or Minimal Wear
Rubber Belt Drive Lugs	5 - Very Light or Minimal Wear
Track Tensioners	5 - Very Light or Minimal Wear
Front Idlers	5 - Very Light or Minimal Wear
Rear Idlers	5 - Very Light or Minimal Wear
Track Rollers	5 - Very Light or Minimal Wear
Sprockets	5 - Very Light or Minimal Wear
Overall Undercarriage Rating	5 - Very Light or Minimal Wear
Left Track Belt - Percent Remaining Estimate	90%
Right Track Belt - Percent Remaining Estimate	90%
Overall Comments	Light to minimal wear no major issues to report

### Chassis Photos

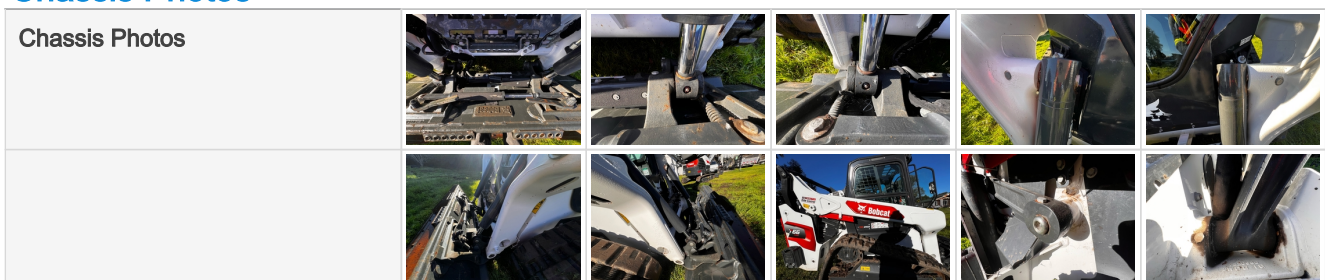



## Inspection Report (Skid Steer/Track Loader)








### Chassis Inspection Points

Frame	5 - Very Light or Minimal Wear
Stance	5 - Very Light or Minimal Wear
Lift Arms	5 - Very Light or Minimal Wear
Chassis to Arm Pins	5 - Very Light or Minimal Wear
Quick Coupler	5 - Very Light or Minimal Wear
Quick Coupler to Arms Pins	5 - Very Light or Minimal Wear
Overall Chassis	5 - Very Light or Minimal Wear
Overall Chassis Comments	Light to minimal wear no major issues to report

### Hydraulics Overall Inspection Points

#### Hydraulics Overall





### Hydraulic System Inspection Points

Hydraulic System Photos	    
Wet or Damp Hydraulic Lines / Fittings	No
Hydraulic Lines/Fittings	5 - Very Light or Minimal Wear
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition
Hydraulic Pump(s)	5 - Very Light or Minimal Wear
Unusual Noises	No
Hydraulic Pump Notes	No unusual noises heard during operation

### Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos	    
---------------------------	--

## Inspection Report (Skid Steer/Track Loader)

					
Mounting Pins	5 - Very Light or Minimal Wear				
Cylinder Oil Leaks	No				
Hydraulic System Overall	5 - Very Light or Minimal Wear				





## Bucket Inspection Points

Bucket Photos					
					
Bucket	5 - Very Light or Minimal Wear				
Bucket Edge / Deflectors	5 - Very Light or Minimal Wear				






## Additional Attachments

### Additional Attachment(s)

### Additional Attachments


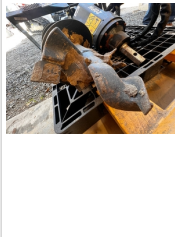




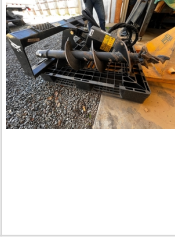

Attachment Type	4' forks				
Attachment Make	Bobcat				
Attachment Size / Specs	4' forks adjustable positions				
Attachment Condition	5 - Very Light or Minimal Wear				
Attachment Photos					

### Additional Attachments (1)

Attachment Type	Pintle hitch				
Attachment Make	Titan				
Attachment Condition	5 - Very Light or Minimal Wear				
Attachment Photos					

### Additional Attachments (2)

## Inspection Report (Skid Steer/Track Loader)

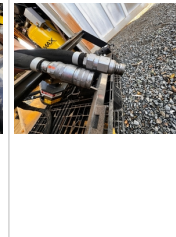Attachment Type	Auger				
Attachment Make	Bobcat				
Attachment Size / Specs	20PH				
Attachment Condition	5 - Very Light or Minimal Wear				
Comments	auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale				
Attachment Photos					
					

## Functional Test

### Functionality Assessment

### Functionality Assessment

Engine	5 - Very Light or Minimal Wear
Transmission/Drivetrain	5 - Very Light or Minimal Wear
Travel (Forward/Reverse/Steering)	5 - Very Light or Minimal Wear
Brakes	5 - Very Light or Minimal Wear
Hydraulic System	5 - Very Light or Minimal Wear
Electric Operating System	5 - Very Light or Minimal Wear
Controls	5 - Service Required - Inoperable
Safety Systems	5 - Very Light or Minimal Wear
Core Functions	5 - Very Light or Minimal Wear
Attachments	5 - Very Light or Minimal Wear
Overall Functional Test Comments	This machine performed as designed no major issues to report

## Overall Assessment

### Overall Assessment



## Inspection Report (Skid Steer/Track Loader)

Inspection Rating Criteria	Rating	Explanation
	5	Light or minimal wear for its age
	4	Expected wear and tear for its age, operates as expected
	3	Above average wear and tear for its age, still operates as expected
	2	Heavy wear, is operable but needs attention
	1	Requires repair(s) to function as expected
Exterior Rating	5 - Very Light or Minimal Wear	
Interior Rating	5 - Very Light or Minimal Wear	
Safety Rating	5 - Very Light or Minimal Wear	
Quality Rating	5 - Very Light or Minimal Wear	
Functionality Rating	5 - Very Light or Minimal Wear	
Overall Rating	5 - Very Light or Minimal Wear	
Summary Video	<a href="#">Click to Download</a>	
What's Great About the Machine	The great thing about this machine is that it has low operating hours and no abnormal noises heard during functional test	
What Needs Work	The thing that needs to work on this machine is the paint scratches on the engine door	
Any Additional Info from the Seller?	auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale	
Date/Time	02-26-2025	
Inspector Name	Javier Bocanegra	
Assessment Details	Boom & Bucket provides an on-site visual inspection of the Unit. The inspection of mechanical components may be limited to starting and running the engine and basic hydraulic movements. Any operational tests are limited to low speeds and are not tested under load. The functionality of locking differentials, transmission shifting, all drive axels, brakes, and auxiliary or high flow hydraulics (unless required for an included attachment) cannot be fully verified. Additional information may be available on request. Please see the terms of services on our website for full details.	